POLE AND ZERO ASSIGNMENT TECHNIQUE FOR POWER SYSTEM CONTROLLER DESIGN

A Thesis Submitted
in Partial Fulfilment of the Requirements
for the Degree of
MASTER OF TECHNOLOGY

By
VIJAY KUMAR SHARMA

to the

DEPARTMENT OF ELECTRICAL ENGINEERING

INDIAN INSTITUTE OF TECHNOLOGY, KANPUR

AUGUST, 1981

EE-1981- M- SHA - POL

66969;

SEP 1981

CERTIFICATE

Certified that this work on 'Pole and Zero Assignment Technique for Power System Controller Design,' by Mr. V.K. Sharma, has been carried out under my supervision and that this has not been submitted elsewhere for a degree.

S. S. Prabhu)

Professor

August, 1981

Department of Electrical Engineering Indian Institute of Technology Kanpur 208016

ACKNOWLEDGEMENTS

My sincere thanks are due to my thesis supervisor, Professor S.S. Prabhu whose kind guidance and valuable suggestions at various stages of the thesis work have benefitted me in the successful completion of the work.

I express my thankfulness to my colleague Mr. S.S. Singh for his help in thesis.

At last, I am also thankful to Mr. J.K. Misra for his neat and accurate typing.

VIJAY KUMAR SHARMA

LIST OF SYMBOLS

System Parameters and Variables:

P	generator power output
Q	generator reactive power output
В	transmission line susceptance
X	transmission line reactance
Xď	synchronous reactance d-axis
X'd	transient reactance d-axis
τ _e	exciter time constant
τs	voltage control feedback loop time constant
τg	gate time constant
τa	governor actuator time constant
τ _w	water time constant
[⊥] e	exciter gain
^l s	voltage control feedback loop gain
^l a	governor actuator gain
σ	permanent droop
Vo	infinite bus voltage, assumed constant
V _t	generator terminal voltage
V _f	field voltage
Pi	mechanical power input
£	field flux linkage
5	torque angle (radians)
1.	speed (rad/sec), after time scaling

```
g gate opening governor feedback loop signal h water head scaled time (sec.) o initial value of a variable (subscript) deviation from the initial value of a variable u_{v}, u_{g} control signals (See eqn. 2.1.5) G_{v}, G_{g} feedback gain rectors
```

ABSTRACT

The thesis considers the problem of improving the output response of a power system, consisting of a synchronous generator driven by a hydraulic turbine, having an exciter voltage regulator and a turbine-speed governor, using pole - and zero assignment by state vector feedback.

A numerical problem has been solved and the results have been compared with those obtained earlier by pole-assignment only. The advantages and disadvantages of the present approach have been discussed.

REVIEW

1.1 Introduction:

One of the most effective methods of controlling a dynamic system is based on the principle of state variable feedback where the input to the system at a given instant, is a linear function of the state of the system at that instant. There are many engineering problems where this type of feedback occurs. For example, the choice of the feedback law may be the direct result of either optimizing a given quadratic performance criterion or reducing sensitivity of the system to plant parameter variations. In still other situations, the feedback law may stem from a desire to achieve arbitrary system dynamics.

It is wellknown [1] that via state-variable feed-back it may be possible to arbitrarily alter the dynamics of the system transfer function. Specifically if the system is controllable, state feedback can achieve arbitrary placement of the system poles, subject only to the condition that the number of poles so specified corresponds to the dimension of the controllable space and wherever complex poles occur, they do so in conjugate pairs. The mechanism by which state feedback affects the

zeros of the system is not so clear except in the case of single input and single output systems [2].

The problem of allocating transfer function zeros as well as poles, is currently under investigation, Chen [3], Fallside and Patel [4] and Wang and Desoer [5], have described some procedures. The procedure described by Murdoch [6] enables specified poles and zeros of a scalar transfer function of a controllable and observable linear system to be obtained by using state vector feedback to two inputs. The number of zeros is equal to the number of zeros in transfer function, before feedback is applied, from one input or the other, whichever is greater. Those zeros which can be changed, and other which cannot, are identified. The former can be made equal to, or arbitrarily close to, any assigned values, and the poles can be assigned arbitrarily.

1.2 Pole and Zero Assignment Technique:

A linear-time invariant system is described by the equations

$$\dot{x} = Ax + Bu$$
 (1.2.1)
 $\dot{y} = c^{T} x$ (1.2.2)

 $y = c^{T} x$ (1.2.2)

where x is an n x l vector, $u = [u_1 : u_2]^T$ is a 2 x l input vector and y is a scalar output, $B = [b_1 : b_2]$, where the n-vectors b_1 and b_2 are linearly independent, and the system

is completely controllable through $oldsymbol{u}_{\mathcal{P}}$ alone.

The feedback vectors \mathbf{k}_1^T and \mathbf{k}_2^T are found such that the system,

$$\dot{x} = [A + (b_1; b_2) (\frac{k_1^T}{T})] x + Bu, y = c^T x (1.2.3)$$

has a transfer function between y and u_1 with as far as possible specified poles and zeros.

The procedure [7] is as follows:

Two sequences of scalars, s, and s, are formed,

$$s_1 = c^T b_1, c^T A^2 b_1, \dots, c^T A^{p-1} b_1$$

 $s_2 = c^T b_2, c^T A^2 b_2, \dots, c^T A^{q-1} b_2$

where, in each case, the sequence terminates at the first non-zero term. The method requires that $q \ge p$. If this condition is not satisfied, a proportion h of the input u_1 is added to u_2 , so that b_1 becomes $(b_1 + hb_2)$. This will make q = p. Feedback vectors k_1^T and k_2^T are found in two stages.

Stage 1:

 k_2^T is first determined so as to locate the zeros. Let k_1^T be a zero vector at this stage. Using a result obtained by Brockett [2], the zeros of the transfer function relating y to u_1 are eigenvalues of the matrix,

$$\{ I - \frac{b_1 c^T (A + b_2 k_2^T)^{p-1}}{c^T (A + b_2 k_2^T)^{p-1} b_1} \} (A + b_2 k_2^T)$$
 (1.2.4)

Since $q \geq p$,

$$c^{T}(A + b_{2}k_{2}^{T})^{p-1} = c^{T}A^{p-1}$$
 (1.2.5)

This is proved in Appendix B.

William Commence

The matrix (1.2.4) may thus be written as,

$$A_0 + b_0 k_2^{T}$$
 (1.2.6)

where,

$$A_0 = \{I - \frac{b_1 c^T A^{p-1}}{c^T A^{p-1} b_1}\} A$$

and
$$b_0 = \{I - \frac{b_1 c^T A^{p-1}}{c^T A^{p-1} b_1}\} b_2$$
 (1.2.7).

The pair (A_0, b_0) is checked for controllability, using any method that permits the identification of the uncontrollable eigenvalues. It is proved in Appendix B that A_0 has the eigenvalue 0 of multiplicity at least p, and that the eigenvalue 0 of multiplicity p is uncontrollable through b_0 . The remaining (n-p) eigenvalues of (1.2.6) are the zeros of the transfer function. Of these, any that are uncontrollable through b_0 cannot be changed, whereas all the rest may be assigned arbitrarily by using modal control theory [8,9] to determine k_2^T . The eigenvalue of multiplicity p has no physical significance, and

arises only because the degree of the numerator of the transfer function in (n-p).

Stage 2:

The system poles will have been changed by the application of feedback k_2^T , and k_1^T is now determined so as to locate the poles as required. It is first necessary to check for controllability of the pair,

$$[(A + b_2 k_2^T), b_1]$$
 (1.2.8)

If this test is satisfied, k_1^T may be found by again using modal control theory [8,9] to move the poles to any desired locations. As is well known, the application of the feedback k_1^T will have no effect on zeros which were established in stage 1, because this feedback is applied to the input from which the transfer function is taken.

If the test for controllability of (1.2.8) fails, controllability can be achieved by making small adjustments to \mathbf{k}_2^T , which means that the zeros in stage 1 can now be made arbitrarily close to assigned values, and not quite equal to them.

1.3 Comparison with Other Techniques:

The use of unity rank feedback for the purpose of pole and zero assignment is very restrictive [4, 10], as, with full state vector feedback, a system with r inputs

can have at most (r-1) zeros assigned, together with all the poles. This will often be insufficient to permit the desired complete specification of poles and zeros.

Another approach, using state vector feedback of rank 2, [6] permits the assignment of all the poles and zeros of a scalar transfer function, subject to some restrictions, but is limited to the class of systems in which inner product of the input and output vector concerned is non-zero. The method described above is the generalisation of this method.

1.4 On the Zeros of a Linear Multivariable System:

Consider the linear time-invariant system,

$$\dot{x} = Ax + Bu \tag{1.4.1}$$

$$y = Cx + Du \qquad (1.4.2)$$

where x is an n-vector, u an m-vector and y is a p-vector. The real matrices A, B,C,D, are of appropriate dimensions.

The following definitions of system zeros (or trans-mission zeros) has been proposed in the literature.

(Z 1):

The zeros of (A,B,C,D) are those complex numbers z such that,

$$\begin{bmatrix} A-z & B \\ C & D \end{bmatrix} < n + \min (m, p)$$

this definition is due to Davison and Wang [11]. Note that if rank of the polynomial matrix,

$$P(s) = \begin{bmatrix} A-s & B \\ C & D \end{bmatrix}$$

is less than $n + \min (m,p)$, then every complex z is a zero of (A,B,C,D).

(Z 2):

Let the rank of P(s) be n+r. Let ϕ (s) be the gcd of all (n+r)-order minors of P of the form $[P]_{j}^{i}$, where,

$$i = (i_1, ..., i_{n+r})$$

$$i_k \in k(k \in n)$$
, $n < i_{n+1} < \dots < i_{n+r} \le i_{n+p}$

$$j = (j_1, ..., j_{n+r}), 1 \le j < ... < j_{n+r} \le n+m$$

The zeros of (A,B,C,D) are the complex roots, including multiplicities, of $\phi(s)$. This definition is due to Rosenbrock [12].

(Z 3):

The zeros of (A,B,C,D) are the complex zeros, including multiplicaties of the (non-zero) numerator polynomials in the McMillan form of the transfer matrix

$$C(sI - A)^{-1}B + D$$

This definition is also due to Rosenbrock [12], although he calls zeros thus defined the zeros of transfer matrix.

(Z4)s

The transfer matrix can be written,

$$C(sI - A)^{-1} B + D = N(s) D(s)^{-1}$$

where N(s), D(s) are polynomial matrices unique upto unimodular equivalence. The zeros of (A,B,C,D) are those complex z such that,

rank
$$N(z)$$
 < rank $N(s)$

This definition can be attributed to Wolovich [16] and Desoer and Schulman [13].

(Z 5):

This 'geometric'definition applies when D = 0, suppose that Λ ,B,C are linear maps, and X a linear space with A: X \to X. Let V* be the largest (A, B)-invariant subspace in Ker C, and R the largest controllability subspace in Ker C. Let F be a linear map such that V* is (A + BF)-invariant (such F always exists). Finally, let $\overline{\Lambda}_F$ denote the map induced by Λ + BF in X/R*. The zeros of (A,B,C) are the roots, counting multiplicities, of the characteristic polynomial of $\overline{\Lambda}_F$ restricted to V*/R*. This definition is due to Morse [14].

It will be convenient to consider two additional definitions.

(2.6):

The zeros of (A,B,C,D) are those complex z such that rank $\begin{vmatrix} A-z \\ C \end{vmatrix}$ = C =

(Z,7):

The zeros of (A,B,C,D) are the roots, counting multiplicities, of the invariant polynomials of P(s).

An essential distinction among the definitions is that $(Z\ 2)$, $(Z\ 3)$, $(Z\ 5)$ and $(Z\ 7)$ include multiplicities whereas $(Z\ 1)$, $(Z\ 4)$ and $(Z\ 6)$ donot.

The following equivalences have been established.

i) If D = 0 then (Z 5) and (Z 7) are equivalent (Corfmat and Morse [15]).

For the next four equivalences assume (A, B) controllable and (C, A) observable.

- ii) (Z 3) and (Z 7) are equivalent (Rosenbrock [12]).
- iii) If D = 0, then (Z 3) and (Z 5) are equivalent (Sebakhy [16] and Moore and Silverman [17]).
- iv) (Z,4) and (Z,6) are equivalent (Wolovich [13]).
- v) Except for multiplicaties (Z 3) and (Z 6) are equivalent (Davison and Wang [11]).

In addition, it is easy to see that

vi) Except for multiplicities (Z 6) and (Z 7) are equivalent

Descer and Schulman have given a nice physical interpretation of zeros as defined in $(Z\ 4)$: λ is a zero if some nonzero input proportional to $\exp(\dot{\alpha}\ t)$ does not excite the output. Davison and Wang have indicated the significance of zeros, as defined in $(Z\ 1)$, for the solvability of a general regulator problem. We adopt the definition $(Z\ 3)$ because it is the natural multivariable extension of the classical single-input/single-output definition.

1.5 Eigenvector Assignment:

In [18] it was stated that `... by a suitable choice of [the state feedback matrix], and hence of some closed—loop eigenvectors, it may be possible to eliminate,... some of the undesired modes e.g. the slower modes. This comment was made in notice of the fact that the feedback control law which caused a closed loop multi-input system to have specified eigenvalues is not unique, with different choices yielding identical eigenvalues but different eigenvectors. Since the influence of each eigenvalue on each state variable response depends on the eigenvectors, control of the modal matrix may be as necessary as satisfying eigenvalue criteria [10].

The process of coupling the effect of the individual modes (eigenvalues) to the state variable responses through

the eigenvector entries is nonlinear. This fact becomes apparent if the state variable response is derived by using the modal canonical form. However, it is possible to identify certain desired closed-loop system structures and consequently associated modal structures.

The eigenvectors may, of course, be modified without disturbing pole locations through the non-uniqueness of the modal control process. There is also insufficient freedom to completely select the individual eigenvector shapes. Following is the formulation for eigenvalue/ eigenvector assignment for multivariable system, given by Srinath Kumar and Rhoten [19].

Consider the completely - controllable, linear time invariant system,

$$\mathbf{\hat{x}} = \mathbf{A}\mathbf{x} + \mathbf{B}\mathbf{u} \tag{1.5.1}$$

where x is the state n-vector, u is the control m-vector, and A and B are constant matrices of appropriate dimensions. The eigenvalue/eigenvector assignment problem may be stated as follows. Find the state feedback law,

$$u = k^{T}x (1.5.2)$$

which gives,

$$A + Bk^{T} = WJV \qquad (1.5.3)$$

where J is the Jordan canonical form with the desired closed loop eigenvalues, W is the required similarity transformation,

 $W^{-1} = V$, and W is to satisfy certain constraints. To see what freedom exists in the choice of W, partition Eqn. (1.5.2) as,

$$\begin{bmatrix} A_{11} & A_{12} & B_{1} \\ A_{21} & A_{22} & B_{2} \end{bmatrix} \begin{bmatrix} k_{1}^{T} & k_{2}^{T} \end{bmatrix}$$

$$= \begin{bmatrix} W_{11} & W_{12} & J_{1} & 0 \\ W_{21} & W_{22} & 0 & J_{1} \end{bmatrix} \begin{bmatrix} V_{11} & V_{12} \\ V_{21} & V_{22} \end{bmatrix} (1.5.4)$$

where A_{ll} , B_{l} , W_{ll} , J_{l} and V_{ll} are m x m matrices, the other matrices are compatibly dimensioned, and B_{l} is assumed to be nonsingular obtained by, at most, a reordering of the state variables. After some algebraic manipulation Eqn. (1.5.4) reduces to,

$$W_{21} J_1 - PW_{21} = TW_{11} + SW_{11} J_1$$
 (1.5.5)
 $W_{22} J_2 - PW_{22} = TW_{12} + SW_{12} J_2$ (1.5.6)

where
$$S = B_2 B_1^{-1}$$

$$T = A_{21} - SA_{11}$$

$$P = A_{22} - SA_{12}$$

and the V's have been suppressed by use of the expressions for the inverse of a partitioned matrix.

Eqns. (1.5.5) and (1.5.6) represent a set of n^2 - nm linear equations in n^2 entries of W and the nm elements of W_{11} and W_{12} can be chosen subject only to the

requirement that W be monsingular. This can be accomplished [20] even when J_1 and J_2 have eigenvalues in common with P. With W chosen, k_1^T and k_2^T are easily evaluated from Eq. (1.5.4).

It is obvious from above analysis that, in general, complete specification of eigenvectors is impossible.

In the present study an attempt was made to develop controller design for a power system by eigenvalue/eigenvector assignment. However, this work could not be completed.

CHAPTER II

POWER SYSTEM PROBLEM CHOSEN

2.1 System Model:

The power system, whose controller is to be designed using pole and zero assignment, consists of a synchronous generator driven by a hydraulic turbine, having an exciter voltage regulator and a turbine-speed-governor, as given in Figures (2.1.1) and (2.1.3). The System was considered by Yu et al [21] for which they obtained a feedback control law using the linear optimal regulator theory for quadratic performance index, and Pai et al [22] who obtained a feedback control law using the modal control approach for pole placement.

The linearized equations of the system considered are:

$$\dot{\mathbf{x}}(\tau) = \mathbf{A}\mathbf{x}(\tau) + \mathbf{B}\mathbf{u}(\tau) \tag{2.1.1}$$

where the state vector is,

$$x(\tau) = \left[\delta \, n \, \psi_{f} \, v_{f} \, v_{g} \, g \, g_{f} \, h\right]^{T} \qquad (2.1.2)$$

The A and B matrices are given by,

	1,3200	0.0	0.0	0.0	0.0 00	0.0	00 -0.1710			
0.0	0.0	0.0	0.0	0.0	-1.3700	-13,700	2,7400			
0.0	0,8820	0.0	0.0	0.0	-0.0616	0.0	0.1230	<u> </u>		0
0.0	0.0	0.0	-1.3700	-0.2740	· 0°0	. 0.0	0.0	0		0 7 0
0.0	0.0	0.1370	-0.1370	0.0	0.0	0.0	0.0	0		0 •
0.0	-0.0816	-0.0254	-0.1070	0.0	0.0	0.0	0.0	0		0
1.0	-0.0346	0.0	0.0	0.0	-0.0265	0.0	0.0531	°	II B	<u>.</u>
0.0	-0.6830	-0.0832	-0.1300	0.0	0.0	0.0	0.0			

FIG.2.1.1 SYNCHRONOUS MACHINE INFINITE BUS SYSTEM

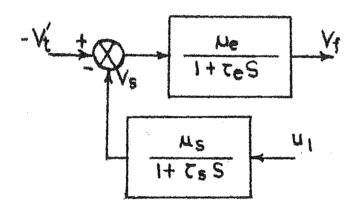


FIG.2.1.2 EXCITER-VOLTAGE REGULATOR SYSTEM

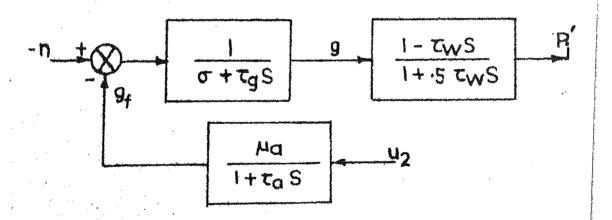


FIG.2.1.3 GOVERNOR-HYDRAULIC SYSTEM

The control vector is given by,

$$u(\tau) = [u_v : u_g]^T$$
 (2.1.5)

The variable in Eqn. (2.1.2) is scaled time and is related to the real time t by the equation

$$\tau = 7.308 t$$
 (2.1.6)

2.2 Numerical Results Obtained by Pai et al:

The modal control configurations considered by M.A. Pai et al, for design are given in Table (2.2.1).

The resulting feedback gain vectors are given in Table (2.2.2).

In the present work the control configuration l is chosen for comparing the results obtained by pole and zero assignment technique with those of Pai et al.

Table 2.2.1: Eigenvalues of the power system.

S.Nc	S.No. Uncontrolled	Cont	Controlled Configurations	ırations
	COMPANIANT, MINISTERNATION AND ANALYSIS PROPERTY PROPERTY PROPERTY AND	T CONTRACTOR OF SECULORS	2	
H	-0.0114	-0.1952	-0.1952	-0.1952
้ญ่	±j 0.7986	-0.2740	-0.2740	-0.2740
w.	-0.0572	7.0-	9.0-	-0.4 + 5 0.915
4.	-0.0772	1+3 0.915	0 0	
U	\\ \	9.0	-0.8	9.0~
9	-0.1952	96.0-	-1.08	8
7.	-0.274	{ ±j0.72	(±j 0.5230	(<u>+</u> jo.8718
φ	-13.7	- 13.7	-13.7	-13.7

Table 2.2.2: Feedback gain vectors.

وي دي هي هي دي			5	0 0	7666.).	25.4274		-1,0508	•	-0.5366	1	0,4686		50,5043		2.9200		8,9352		The state of the s
rations	2		GV		1,3822	7831 O		7, 2,688	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	701/0 z	7.6.76	7 1/156		9997.61	1	0.2667		8 2778		
Modal Control Configurations			ರ		1,4505	(-7.9841	(((0.1510	r L t	0.1221		0.2700	6890 11	7000 • 77	0000	T. 3200		14.4720	
Modal Cont	CHAIN STATE AND MOTE SIAN CODE SAME PARTS AND ADDRESS.	7	5	\ 	0.5708		0.2298		1,8014		1,2259	,	-2.0056	1	-6.4963		0.0693		-2.8549	-
	يجو ويته خون فيها ويتواهي فيهد فيه فيه فيه الم		T)	තර	0 8812	1400.	F 0268	1).0000	0.0857		-0.1003))	0.1831		8,3796		-1.3200		-2.6776	q
		THE REAL PROPERTY AND PARTY AND PARTY AND PARTY AND PARTY AND PARTY.		۵,		7784.0	0.70 г	0.1840	בסרס י	TOTO*T	מצטניר	T. CO.O.	7777	1. (O)	5 5657	1000	0 0033	7770.0	-2.7737	

CHAPTER III

POSING OF THE PROBLEM

3.1 The Statement of the Problem:

System is described by Eqns. (2.1.1) to (2.1.6). Pole and zero assignment is done for following three cases, with output vectors:

i)
$$c_1^T = [10000000]$$

ii)
$$c_2^T = [01000000]$$

iii)
$$c_3^T = [00100000]$$

The pole locations are chosen to be the same as of conf. 1. in Table (2.1) for all the three cases, so that the results could be compared with those obtained by Pai et al. And zeros are placed such that dominant poles are cancelled, i.e., pole-zero cancellation is tried.

3.2 Numerical Results:

Case 1:

The number of zeros is 4 in this case, so they are placed at the locations of the first four dominant poles. While forming series s_1 and s_2 (Sec. 1.2) it was found that p > q, so b_1 was modified as follows:

$$b_1 = b_1 + 0.5 b_2$$

The final pole-zero locations and the feedback vectors are given in Table (3.2.1).

Case 2:

The number of zeros in this case is 5, one of them is uncontrollable. In this case also \mathbf{b}_1 is modified as,

$$b_1 = b_1 + 0.5 b_2$$

The results are given in Table (3.2.2).

Case 3:

In this case also the number of zeros is 5, all of them are controllable. The results are given in Table (3.2.3).

The transient responses of the controlled system states are shown in Fig. (3.2.1) to (3.2.8).

Table 3.2.1:


_	Variable and the Array of the A	10,450791 0.0	14830 0.0	3.142396 -0.368624	0.984485 -0.417870	-0.918442 0.452862	331365 22.55	334313. 0.0	371058 0.0	And the state of t
	Controlled		9999792		0032		(- 0.5999981 -72.831365	- 0.2739983 -4.334313.	- 0.1952008 -36.371058	
Poles	 led Uncontrolled	-0.1951954 -10.8298900 -13.7	6 - 2.9531830	[-0.399999 [- 0.01741947] ± j0.91	1+ 10.8276846 (- 0.9600032	(- 0:0755680	4.3 0.1011295	- 0.1604063	- 0.274	
TOYOG	Incontrolled Controlled Uncontrolled Controlled	7561561 0 1947463 0 1951957			Auran	4. [+]0. +00K/ 10[+]0./+				


Table 3.2.2


•	. Zei	Zeros		Poles	Feedback Gain Vectors	Vectors
	Uncontrolled	Controlled	Uncontrolled	Controlled		1)
					> 5	OG
٠	-0.1947463	-0.1951954	-10,82989	-13.7	10.450791	0.0
	-0.0441110	-0.2740036	- 2.953183	- 0.399979	-20.614830	0.0
-	-0.0623096	6666662.0-	4764710-0	[±j 0.91	3,142396	-0,368624
· · · · · · · · · · · · · · · · · · ·	. +j0.4002740	(±3 0.91	(±) 0.8276846	- 0.9600032	0.98448552	-0,417870
	0.0	0.0	0.075568	(±j 0.7200023	-0.91844261	0.452862
	ı	1	(+j 0.1011295	- 0.5999981	-72,831365	22,55
4	· ·	. 1	- 0.1604063	- 0.2739983	-4.3343132	0.0
, .	1	1	- 0.274	- 0.1952008	36.371058	0.0
	to de trois de trois de la company de company de la compan					


Table 3.2.3


	Ze	Zeros			HAPANA Calvara	v Vootes
	Noted spills dates delicts seem dates where these desire death depart depart makes	e biomater way deal with the last way with the color of the color	A TOJ		Top woods and	TI VECTOF
	Uncontrolled	Controlled	Uncontrolled	Controlled		
Ţ.	-0.0062861	-0.1976145	-13.7	=13.7	-0,9351278	
2.	+j0.8002425	-0.2724868	- 0.400795	7000096*0 -	_1,2195057	7.878
ž	-0.1978477	-0.3996692	+j0.9148718	+j0.7200001	4.1101374	
. 4.	-0.0567802	+10.90977	- 0.263493	- C.4	7,5990116	
Ŋ	-13.7	-13.7	+30.0497437	4,10,9099999	-2.08336	9.0
ં	ı	1	- 0.0516319	- 0.5999998	-0.76443076	
.	ı	i	±j0.0975285	- 0.1952002	-0.35639923	1,00224
ထိ	f	ij	- 0.274	- 0.2739997	-0.84459831 -4.40952	7-
CONTRACTOR CO.						1//

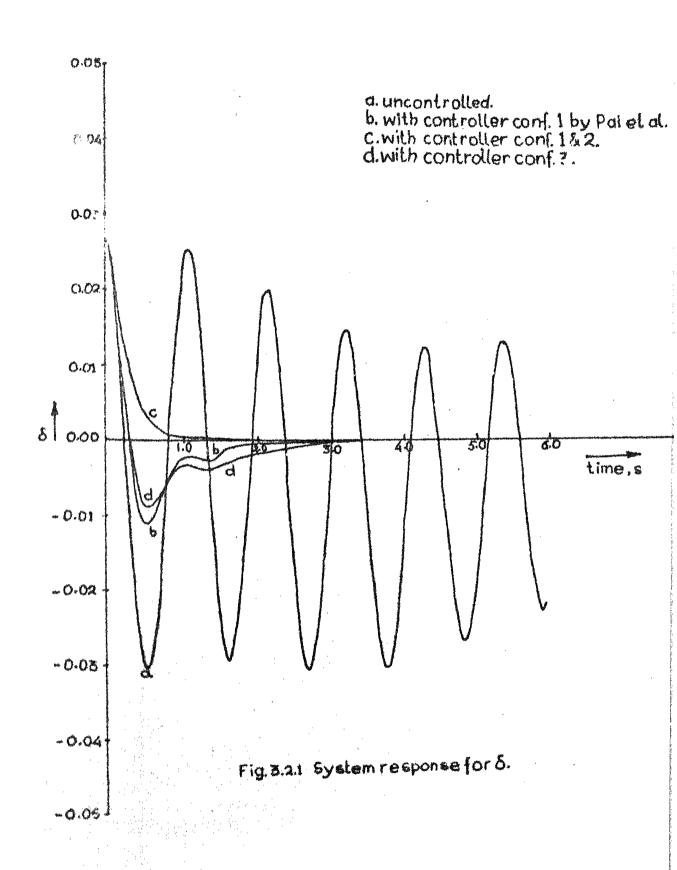


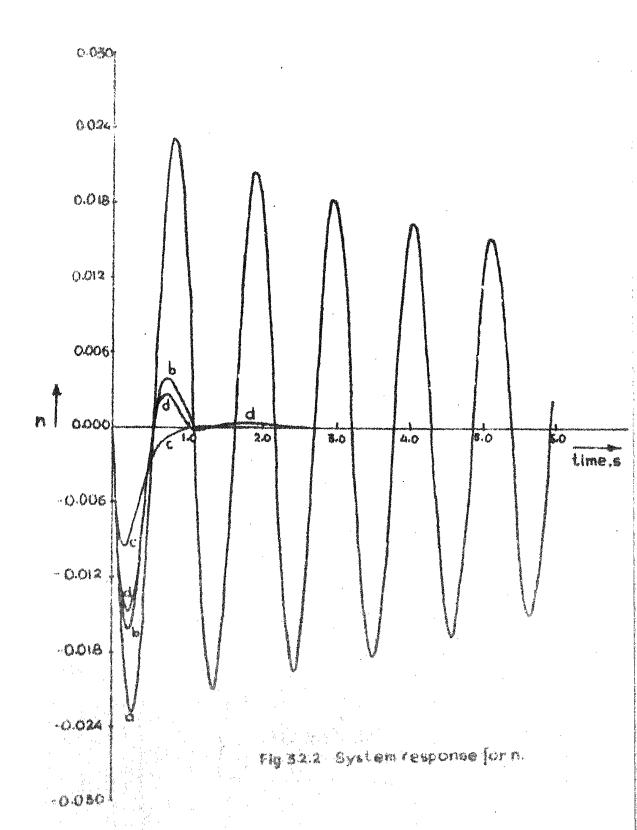


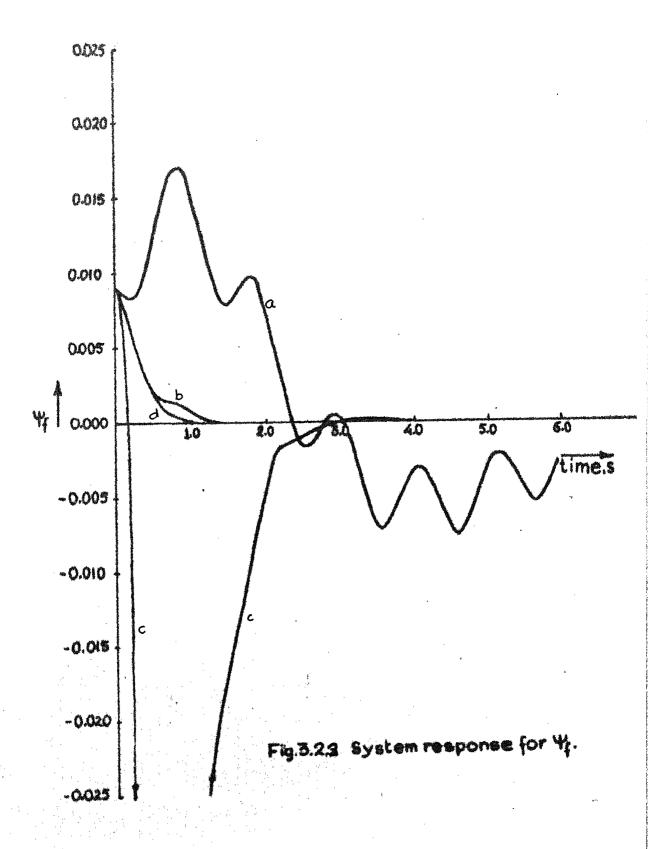


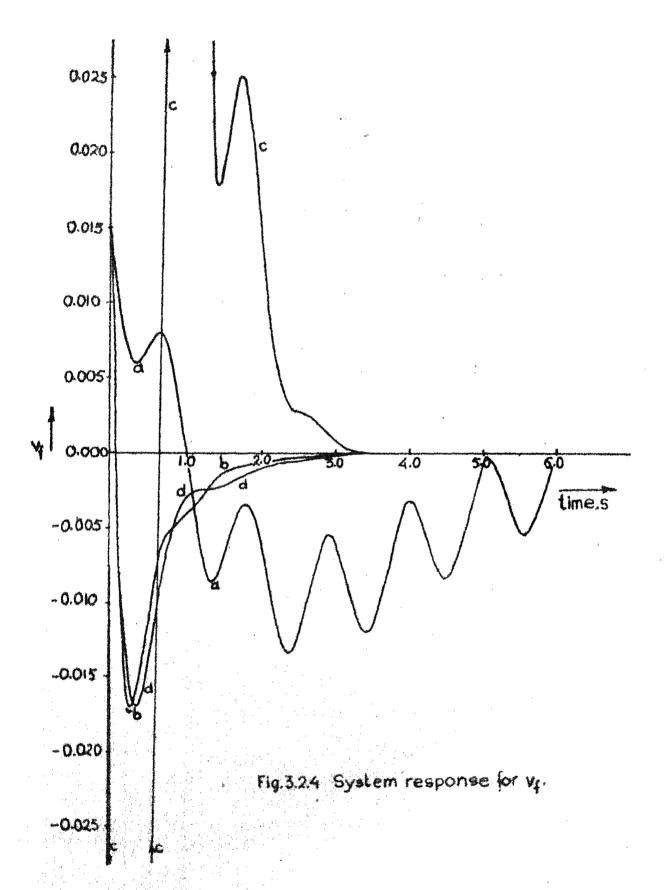

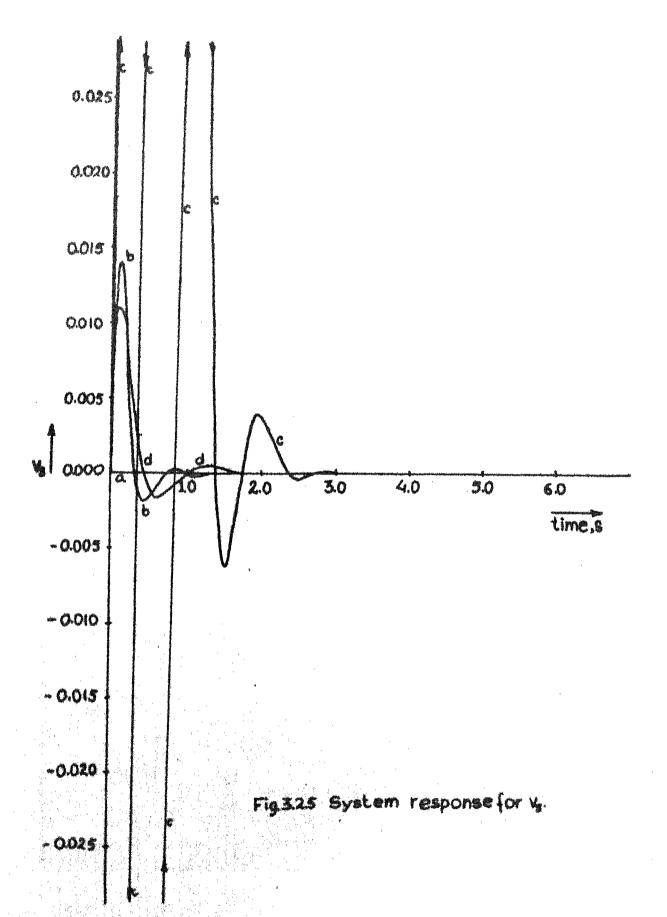

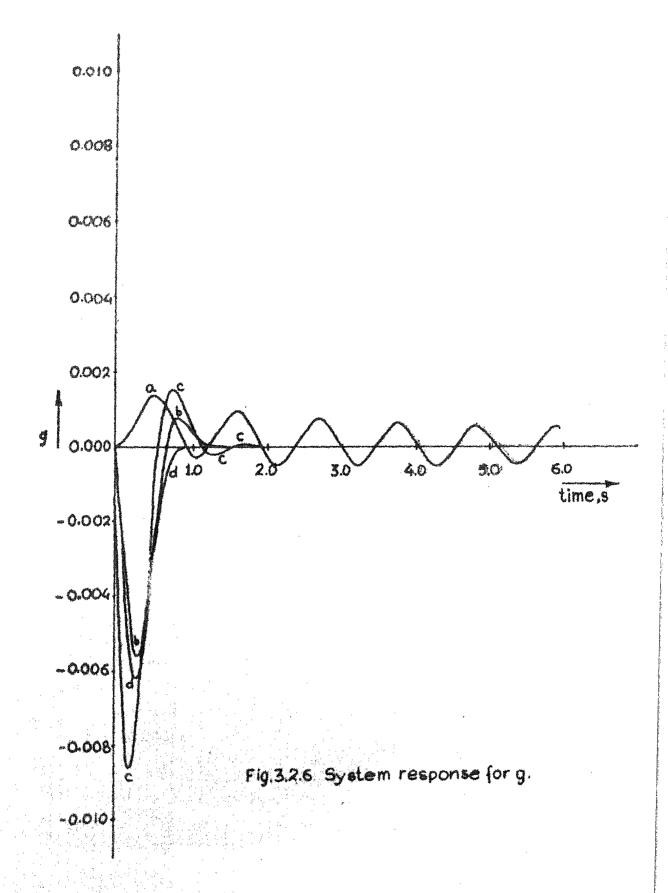

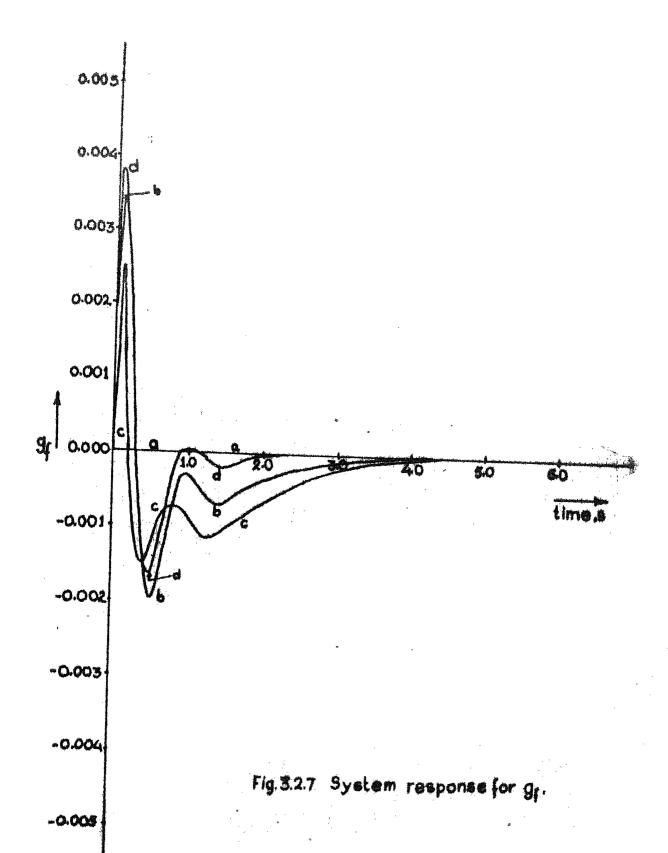

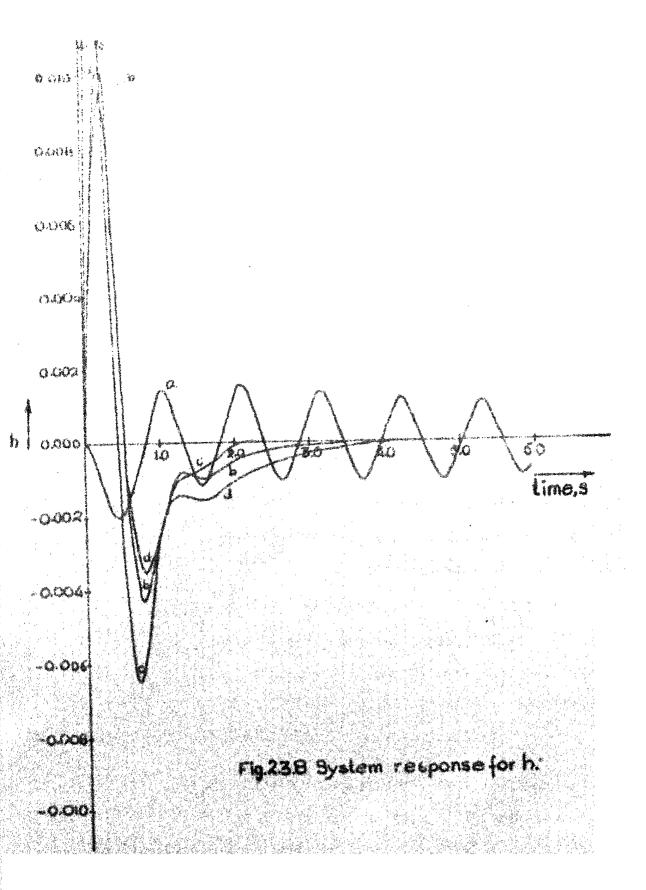

CONCLUSIONS

The feedback controllers for different output vectors are obtained. The poles and zeros of the transfer function relating y and u_l are successfully placed. The advantages of this approach over the others are discussed (Sec. 1.3).

Following are the conclusions of study:

- 1) Pole-zero cancellation yielded very good output response, e.g. response corresponding to state variables ξ , n and ψ_f for output vectors c_1^T , c_2^T and c_3^T respectively.
- System responses corresponding to different states for control configurations 1 and 2 shows that the response for some states may become bad (e.g. for states ψ_f , v_f and v_g) while for other it is quite good.
- There may be some output vector, which will give the satisfactory response for all the states (e.g. c_3^T). The responses obtained with c_3^T are as good as those obtained by Pai et al, and sometimes better.

If the system has more than two inputs, u can be used for zero assignment, other remaining inputs can be used for placing poles. More generally a specified linear combination of a certain inputs can be used for zero placement and rest of the inputs for pole placement.

REFERENCES

- 1. Wonham, W.M., 'On pole assignment in multiple-input controllable linear system,' IEEE Trans.Auto.Control, AC-12, pp.660-665, Dec. 1967.
- 2. Brockett, R.W., 'Poles, zeros and feedback: state space interpretation,' IEEE Trans. Auto.Control, AC-10, pp.129-135, April, 1965.
- 3. Chen, R.T.N., 'A method of pole-zero placement for Multivariable control space, 'Proc. of the JACC Conf., pp. 901-907, 1971.
- 4. Fallside, F. and Patel, R.V., Pole and zero assignment for linear multivariable system using unity rank feedback, Electronic Letters, 8, pp. 324-325, June, 1972.
- 5. Wang, S.H. and Desoer, C.A., The exact modal matching of linear multivariable systems, IEEE, Trans. Auto. Control, AC-17, pp. 347-349, June, 1972.
- 6. Murdoch, P., 'Pole and zero assignment by proportional feedback,' IEEE Trans. Auto.Control., AC-18, p.542, Oct. 1973.
- 7. Murdoch, P., 'Pole and zero assignment by state-vector feedback', Automatica, 11, pp. 199-201, 1975.
- 8. Mayene, D.Q. and Murdoch, P., 'Modal control of linear time-invariant systems, 'I.J.C. 11, pp. 223-227, 1976.
- 9. Retallack, D.G. and MacFarlane, A.G., 'Pole shifting techniques for multivariable feedback systems,' Proc. IEE 117, pp. 1037-1038, 1970.
- 10. Fallside, F. and Seraji, H., 'Design of multivariable systems using unity rank feedback, 'I.J.C. 17, pp.351-364, 1973.
- 11. Davison, E.J., and Wang, S.H., Automatica 10, pp. 643,1974
- 12. Rosenbrock, H.H., 'State-space and multivariable theory,' I.J.C., 19, pp. 508, 1974.
- 13. Wolovich, W.A., IEEE Trans. Auto.control, 18, p.542,1973.

- 14. Morse, A.S., J.SIAM Control, 11, p. 446, 1973.
- 15. Corfmat, J.P., and Morse, A.S., 'Control system report,'
 Department of Electrical Engineering and Applied
 Science, Yale University, June, 1974.
- 16. Sebakhy, O.A., Ph.D. Thesis, Department of Electrical Engineering, University of Toronto, 1974.
- 17. Moore, B.C., and Silverman, L.M., Proc. JACC, Univ. of Texas, p. 186, 1974.
- 18. Shaw, S.L., Fisher, D.G., and Seborge, D.E., 'Disturbance localization in linear time invariant multivariable systems,' Elect. Lett. 10, p. 513, 1974.
- 19. Srinath Kumar, S., and Rhoten, R.P., 'Eigenvalue/eigenvector assignment for multivariable system,' Elect. Lett., 11, pp. 124-125, 1975.
- 20. Chidambram, M.R., Broen, R.B., and Zaborzky, J.,
 'A simple algorithm for pole assignment in a multiple input linear-time-invariant dynamical system,' Trans.
 ASME, 96, pp. 13-18, 1974.
- 21. Yu, Y.N., Vonsuriya, K., and Wedman, L.N., IEEE Trans. Power Apparatus Systems, 89, p. 55.
- Pai, M.A., Prabhu, S.S. and Ramana, I.V., 'Modal control of a power system,' IJC, 6, pp. 87-100, 1975.

APPENDIX A

Formation of Matrix (1.2.4):

Consider the linear time-invariant system described by the eqns.

$$\dot{x} = Ax + bu$$
 (Al)

$$y = c^{T}x (A2)$$

where b and c are n-vectors.

By repeated differentiation of (A2) and substituting for \dot{x} from (A1), we obtain a set of equations. ($y^{(i)} = \frac{d^i y}{dt^i}$)

$$y^{(0)} = c^{T}x$$

$$y^{(1)} = c^{T}Ax + c^{T}bu^{(0)}$$

$$y^{(2)} = c^{T}A^{2}x + c^{T}Abu^{(0)} + c^{T}bu^{(1)}$$

$$\vdots$$

$$y^{(n)} = c^{T}A^{n}x + c^{T}A^{n}bu^{(0)} + c^{T}A^{n-1}bu^{(1)} + ... + c^{T}bu^{(n-1)}$$

Consider the sequence of scalars c^Tb , c^TAb ,..., $c^TA^{n-1}b$. In general, it cannot be assumed that c^Tb is non zero, or c^TAb is nonzero, etc. However, if all the terms in this sequence are zero then clearly u has no effect on y, and hence, the transfer function is zero. Assuming that this is not the case, we define the numbers α and q as,

$$\alpha = i$$
 where $c^T A^{i-1}b \neq 0$ and $cA^{j}b = 0$

$$for 0 \leq j \leq i-1 \qquad (A4)$$

and,
$$q^{-1} = \{ \begin{array}{cc} 0 & \text{for } \alpha = 0 \\ c^{T}A^{\alpha - 1}b & \text{for } \alpha \neq 0 \end{array} \right.$$
 (A5)

Both α and q have simple interpretation in terms of transfer function. In fact α is the difference in the degree of numerator and denominator polynomials and

$$q^{-1} = \lim_{s \to \infty} s^n G(s)$$

We will call α the relative order of the system.

In terms of this notation, it is seen that u is given by $qy^{(\alpha)} - qc^TA^{\alpha}$. Substituting this into (Al), the pair of equations,

$$\dot{x} = (\Lambda - bqc^{T}\Lambda^{\alpha}) x + bqy^{(\alpha)}$$
 (A6)

$$u = -qc^{T}A^{\alpha}x + qy^{(\alpha)}$$
 (A7)

are obtained. This pair defines what we call as the inverse system.

By taking transform of (A6) and by using the transform of (A7) we arrive at the frequency domain equation,

$$u = -qc^{T}A^{\alpha}(sI - A + bqc^{T}A^{\alpha})^{-1}bqs^{\alpha}y + qs^{\alpha}y$$
 (A8)

Since the zeros of the transfer function \tilde{y}/\tilde{u} are the poles of the transfer function \tilde{u}/\tilde{y} , and since the latter are the eigenvalues of A-bqc^T Λ^{α} , we see that the zeros of the original system must be eigenvalues of A-bqc^T Λ^{α} .

Now for the closed loop system (1.2.3) we have,

$$u_1 = -\bar{q}c^T \bar{A}^p (sI - \bar{A} + b_1 \bar{q}c^T \bar{A}^P)^{-1} b_1 \bar{q}s^p y + \bar{q}s^p y$$
 (A9)

where,
$$\bar{\Lambda} = \Lambda + b_2 k_2^T$$

and,
$$\ddot{q} = c^T (\Lambda + b_2 k_2^T)^{p-1} b_1$$

here it is assumed that k_1^T = 0. Therefore the zeros of the transfer function y/u_1 (Sec. 1.2) are the eigenvalues of the

matrix:
$$\overline{A} - b_1 \overline{q} c^T \overline{A}^p = (I - b_1 \overline{q} c^T \overline{A}^{p-1}) \overline{A}$$

$$= \left[I - \frac{b_1 c^T (A + b_2 k_2^T)^{p-1}}{c^T A^{p-1} b_1}\right] (A + b_2 k_2^T)$$

which is the same as (1.2.4).

a) Proof of Eq. (1.2.5):

By considering vector of the form

$$c^{T}(A + b_{2}k_{2}^{T}) = c^{T}A + c^{T}b_{2}k_{2}^{T} = c^{T}A, \text{ if } c^{T}b_{2} = 0$$

$$c^{T}(A + b_{2}k_{2}^{T})^{2} = c^{T}A(A + b_{2}k_{2}^{T}) = c^{T}A^{2} + c^{T}Ab_{2}k_{2}^{T}$$

$$= c^{T}A^{2}, \text{ if } c^{T}b_{2} = 0 \text{ and } c^{T}Ab_{2} = 0$$

and so on, it is easily seen that, since $c^T A^i b_2 = 0$, i = 0, ..., q-2,

$$c^{T}(\Lambda + b_{2}k_{2}^{T})^{i} = c^{T}\Lambda^{i}, i = 0, ..., (q-1)$$
 (B1)

eqn. (1.2.5) follows, since $q \ge p$.

b) Proof that A has eigenvalue of multiplicity at least p:

The eigenvalues of $\Lambda_{\rm O}$ are the roots of the characteristic equation,

$$| sI - A + \frac{b_1 c^T A^p}{c^T A^{p-1} b_1} | = 0$$
 (B2)

which may be written,

$$|sI - A| |I + \frac{(sI-A)^{-1} b_1 c^T A^p}{c^T A^{p-1} b_1}| = 0$$

using the result, $|I + fg^T| = (1 + g^T f)$, where f and g^T are column and row vectors. respectively. The equation becomes,

$$|sI-A| \{1 + \frac{c^{T}A^{p}(sI - A)^{-1}b_{1}}{c^{T}A^{p-1}b_{1}}\} = 0$$

Setting s=0 makes expression in curly brackets zero. So that 0 is a root. Differentiating the expression in curly brackets with respect to s and setting s=0, makes this expression zero, because $c^T\Lambda^{p\to 2}b_1=0$. Repeating this operation (p-1) times, and remembering that $c^T\Lambda^ib_1=0$ for $i=0,\ldots(p-2)$, shows that the expression in curly brackets has the root 0 of multiplicity p, so that A_0 has the eigenvalue 0 of multiplicity at least p.

c) Proof that in Eq. (1.2.6) the Eigenvalue O of Multiplicity p is Uncontrollable Through bo:

The matrix (1.2.4) is of the same form as A_0 , except A is replaced by $(A + b_2 k_2^T)$. It follows from (B1) and from the rules of formation of s_1 and s_2 that the value of p and q are unchanged if, in these sequences A is replaced by $(A + b_2 k_2^T)$. Thus by the same argument in (b), the matrix (1.2.4) and hence (1.2.6) has the eigenvalue O of multiplicity at least p, for all k_2^T . This statement implies that the eigenvalue O of multiplicity p is uncontrollable through b_0 .

APPENDIX C

Proof that Feedback k1 has no effect on zeros established in Stage 1:

Consider the single input system S,

$$\dot{x} = \tilde{A}x + b_{\gamma}u_{\gamma} \tag{C1}$$

$$y = e^{T}x$$
 (C2)

where $\widetilde{A} = A + b_2 k_2^T$, x and y are n-vectors, u_1 is a scalar. Assume that the system is controllable, in which case without loss of generality, we may represent (\widetilde{A}, b_1) in phase variable canonical form as follows:

$$A = \begin{bmatrix} 0 & 1 & 0 & \dots & 0 \\ 0 & 0 & 1 & \dots & 0 \\ \vdots & \vdots & \vdots & \ddots & \vdots \\ 0 & 0 & 0 & \dots & 1 \\ -a_0 & -a_1 & -a_2 & \dots & -a_{n-1} \end{bmatrix}, b = \begin{bmatrix} 0 \\ 0 \\ \vdots \\ 0 \\ 1 \end{bmatrix}$$

Let the feedback law be given by,

$$u = k_1^T x + v \tag{C3}$$

The system \overline{S} resulting from feedback has the following form,

$$\dot{\overline{x}} = (A + bk_1^T) \overline{x} + bv$$

$$y = c^T \overline{x}$$

Let h(s) and $\overline{h}(s)$ denote transfer functions of S and \overline{S} respectively. We have

It is readily verified that,

$$q_{i}(s) = \overline{q}_{i}(s) = C_{i1} + C_{i2}s + ... + C_{in}s^{n-1}$$
for $i = 1, 2, ..., n$

Thus numerator polynomial is invariant to state feedback $\mathbf{k}_{1}^{T}\boldsymbol{.}$

$$h(s) = c^{T}(sI-A)^{-1}b, \quad \overline{h}(s) = c^{T}(sI-(A+bk_{1}^{T}))^{-1}b$$

If d(s) and $\overline{d}(s)$ are the characteristic polynomials associated with systems S and \overline{S} respectively, then

$$h(s) = \frac{1}{d(s)} [q(s)]$$
 and $\overline{h}(s) = \frac{1}{\overline{d}(s)} [\overline{q}(s)]$

where q(s) and $\bar{q}(s)$ are column vectors whose n entries are polynomials in s.

Admittedly d(s) and $\overline{d}(s)$ are different. We now prove that q(s) and $\overline{q}(s)$ are identical irrespective of the choice of the feedback matrix k_1^T . The proof is as follows:

Since b in a column vector with all entries zero except the last which is unity, it is easily seen that only the last column of $(sI - A)^{-1}$ is involved in the product $(sI - A)^{-1}$ b. Further since A is a companion matrix, the last column of $(sI-A)^{-1}$ is given by $[1,s,s^2,...s^{n-1}]^T$. Also $\overline{A} = A+bk_1^T$ is a companion matrix and hence identical arguments show that the last column of $(sI-\overline{A})^{-1}b$ is given by $[1,s,s^2,...,s^{n-1}]^T$.

Hence $(sI-A)^{-1}b = (sI-A)^{-1}b = [1, s, s^2, ..., s^{n-1}]^T$

Now calculating h(s) and $\overline{h}(s)$, we have

$$h(s) = \frac{1}{d(s)} [q_1(s), q_2(s), \dots, q_n(s)]^T \text{ and}$$

$$\bar{h}(s) = \frac{1}{\bar{d}(s)} [\bar{q}_1(s), \bar{q}_2(s), \dots, \bar{q}_n(s)]^T$$